## REVIEW OF SENSORS AND TRANSDUCERS

#### Sensors

- Devices such as a photocell that respond to a signal or stimulus. A device that measures or detects a real-world condition, such as motion, heat or light and converts the condition into an analog or digital representation. These devices are use in manufacturing plants to tell how many items are in a package such as the example CD's to fill a container for packaging or to the number of containers fill case for shipment.
- Good examples: motion detectors and burglar alarms

#### Sensors(contd.)

The sensor converts energy from one form to another, the second being related to the original energy in some predetermined way.

As an example, let us consider a microphone. Sound energy in the air surrounding the microphone interacts with this sensor, and some of the energy is used to generate an electrical signal. This electrical signal is related to the sound entering the microphone in such a way that it can be used to produce a similar sound at a loud speaker when appropriately processed.

## Contd.

- Thus, the microphone has acted as a transducer. The loud speaker has also acted as a transducer since it converted the electrical energy back to sound.
- *We will distinguish* them by considering a sensor as a very low energy device that performs an energy conversion for the purpose of making a measurement.
- Note: The terms sensor and transducer are often used interchangeably.

### Contd.

#### Sensor


**Importance** 

Sensor is an important part of measurement as well as instrumentation system.

#### TRANSDUCERS

### What is transducer?

Non-electrical physical quantity: temperature, sound or light

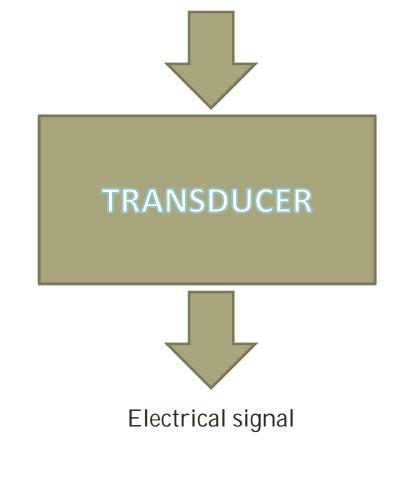

### Introduction

- A transducer is an electronic device that converts energy from one form to another for various purposes like measurement or Information transfer eg., Pressure sensors.
- Common examples include microphones, loudspeakers, thermometers, position and pressure sensors, and antenna.

### Transducer efficiency

 Efficiency is an important consideration in any transducer. Transducer efficiency is defined as the ratio of the power output in the desired form to the total power input. Mathematically, if P represents the total power input and Q represents the power output in the desired form, then the efficiency E is given by:

#### Contd..

- No transducer is 100-percent efficient; some power is always lost in the conversion process. Usually this loss is manifested in the form of heat. Some antennas approach 100-percent efficiency.
- The worst transducers, in terms of efficiency, are incandescent lamps. A 100-watt bulb radiates only a few watts in the form of visible light. Most of the power is dissipated as heat

### Significance of transducer in measureme & instrumentation system contd....

- First stage(sensing device):-If the quantity under measurement i.e. the non-electrical quantity should be into electrical signal by the device transducer
- <u>Note</u>: Here it is imp. to discuss the term **sensor**. The sensor is a part of transducer which senses or responds to a physical quantity or measurand. The response of sensor is converted to electrical signals by the transduction stage.

### Significance of transducer in measureme & instrumentation system contd.....

#### Second stage(Signal conditioning):-

Function of this stage is amplification,filteration,conversion etc of the o/p of transducer so that it can be compatible with the o/p device or stage.

• <u>Third stage(output)</u>:- The o/p of Signal conditioning stage is displayed or monitored on display devices, recorders. These devices are CRO, magnetic tape, printer, computer etc.

On the basis of method used for Transduction:

- Active and Passive
- Analog and digital transducer
- Transducer and inverse transducer
- Primary and secondary transducer

- Active or Self generating type do not require an external power, and produce an analog voltage or current when stimulated by some physical form of energy
  - Thermocouple
  - Photovoltaic cell
  - Tachogenerators
  - Piezoelectric crystals

- Passive transducers require an external power, and the output is a measure of some variation (resistance or capacitance)
  - Slide-wire resistor
  - Resistance strain gauge
  - Differential transformer


- Analog Transducers-These transducers convert the input quantity into an analog output which is a continuous function of time.
  - Strain Gauge
  - LVDT
  - Thermocouple
  - Thermistor

- Digital Transducers-These transducers convert the input quantity into an electrical output which is in the form of pulses.
  - Glass Scale can be read optically by means of a light source, an optical system and photocells.

- Transducers and Inverse Transducers-
- -A Transducer can be broadly defined as a device which converts a non-electrical quantity into an electrical quantity.
- Ex:-Resistive, inductive and capacitive transducers
- -An inverse transducer is defined as a device which converts an electrical quantity into a non-electrical quantity.
- Ex:-Piezoelectric crystals

• Primary Transducers and Secondary Transducers-

Bourden tube acting as a primary detecter senses the pressure and converts the pressure into a displacement of its free end.The displacement of the free end moves the core of a linear variable differential transformer(LVDT) which produces an output voltage.

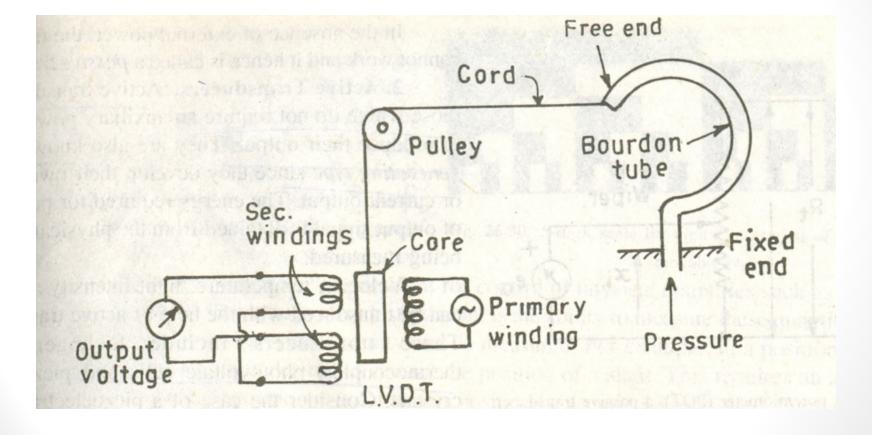

## **Characteristics of Transducers**

- Input characteristics
- -Type of input and operating range
- -Loading effects
- Transfer characteristics
- -Transfer function
- -Error
- -Response of transducer to environmental influences
- Output characteristics
- Environmental response

## Factors affecting choice of transducer

- Operating Principle
- Sensitivity
- Operating Range
- Accuracy
- Cross sensitivity
- Errors
- Transient and Frequency response

## Factors affecting choice of transducer


- Loading Effects
- Environmental Compatibility
- Insensitivity to Unwanted Signals
- Usage and Ruggedness
- Electrical Aspects
- Stability and Reliability
- Static Characteristics

#### **Resistive Transducers**

 It is used for ac as well as dc current and voltages measurements.

•  $R = \rho L/A$ 

#### 1)Potentiometers

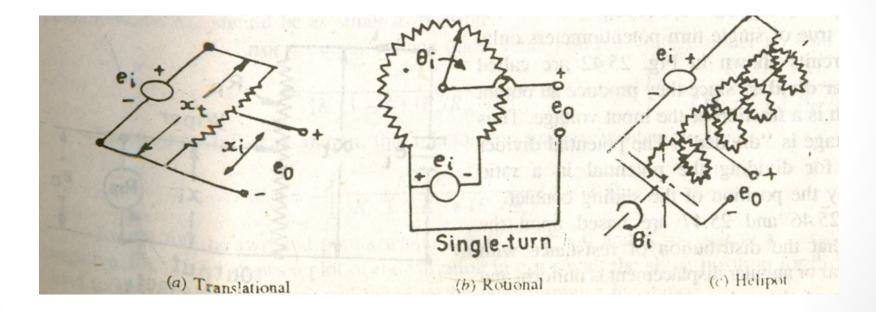


## 1)Potentiometers Contd...

- The Translation elements are straight devices & have a stroke of 2mm to 0.5m.
- The rotational elements are circular in shape and are used for measurement of angular displacement small as 10°(full scale angular displacement)
- The Helipots may measure upto 3500° of rotation.

### **Resistive Transducers**


<u>Characteristics of potentiometer-</u>

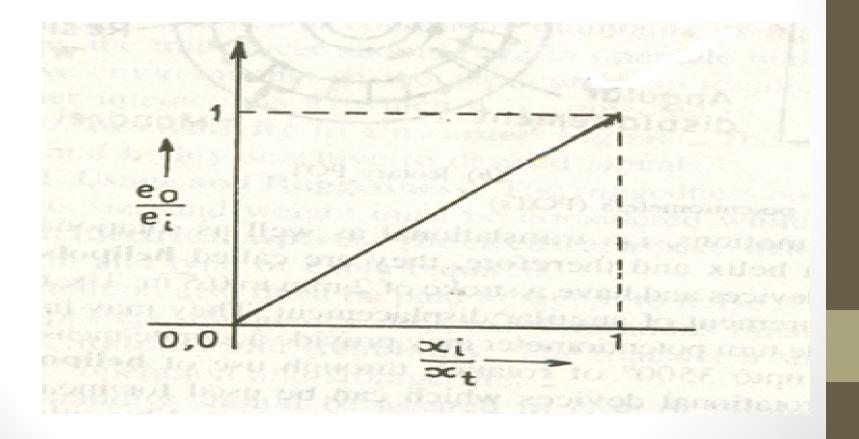


### **Resistive Transducers**

- e<sub>0</sub>= (<u>resistance at the output terminals</u>)\*input voltage resistance at the input terminals
- $e_{0=}[R_p(x_i/x_t)/R_p]^*e_i = (x_i/x_t) e_i$
- Sensitivity S=output/input= $e_0/x_i=e_i/x_t$
- Under ideal conditions the sensitivity is constant & the o/p is faithfully reproduced & has a linear relationship with i/p.

#### Loaded potentiometer

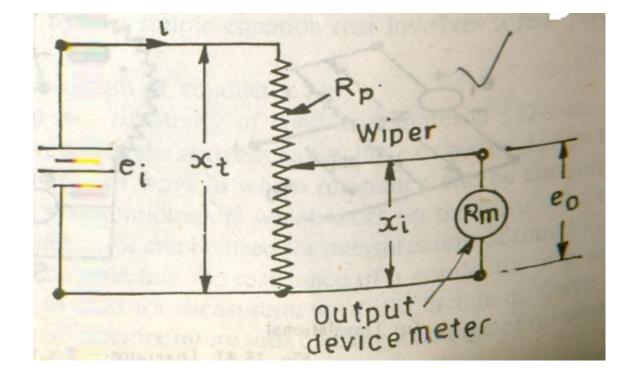

## Characteristics of potentiometer

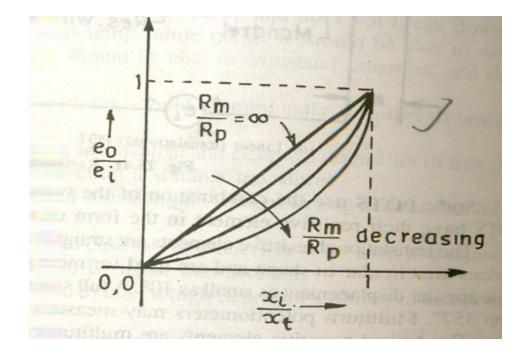

## Power rating of potentiometer

- The potentiometer are designed with a definite power rating which is directly related to heat dissipating capacity.
- A single turn potentiometer with diameter of 50mm with a wide range of ohmic values ranging from 100 Ω to 10kΩ.
- They have same heat transfer capabilities.
- Their rating is 5W at an ambient temp.of 21°C.
- Since power P = e<sub>i</sub><sup>2</sup>/R<sub>p</sub>, the max.i/p excitation voltage that can be used is

$$(e_i)max = vPR_p, volt$$

## Linearity and sensitivity

- In order to achieve good linearity, the resistance of potentiometer R<sub>p</sub>, should be as low as possible when using a meter for reading the o/p voltage which has a fixed value of i/p resistance R<sub>m</sub>. The R<sub>p</sub> cannot be made low because if we do so the power dissipation goes up with the result we have to make the i/p voltage small to keep the power dissipation to acceptable level. this results in lower sensitivity.
- In order to achieve high sensitivity the o/p voltage e<sub>o</sub> should be high which ion turn requires a high i/p voltage e<sub>i</sub>.
- The Linearity and sensitivity are therefore two conflicting requirements.

## Materials used for potentiometer

#### 1.Wire Wound Potentiometer:

- These are platinum ,nickel chromium,nickel copper,or some other precious resistance elements.
- It carry relatively large currents at high temperatures.
- Their resistance temperature coefficient is usually small is of the order of 20\*10<sup>-6</sup>/°C or less.
- Resolution is 0.025 0.05 & is limited by the number of turns that can be accommodated on the card.
- The interwinding capacitance b/w turns & b/w windings & shaft, housing etc. limits the use of wire wound potentiometer to low frequencies to about 5Hz.
- Max speed is about 300rpm.

## Materials used for potentiometer

#### 2. Non Wire Potentiometer or Continuous Potentiometer:-

- It has improved resolution & life.
- Max speed is 2000rpm.
- They are more sensitive to temperature changes, have a higher wiper contact resistance, which is variable & can carry moderate currents.

#### Materials used for Non Wire Potentiometer are :-

1. Cermet:-It uses precious metal particles fused into ceramic base & these fused particles acts as a resistance elements.

#### <u>Advatages :</u>

1.Large power ratings at high temperatures.

2. Low cost.

3. Moderate temperature co-efficients of the order of 100\*10<sup>-6</sup>/°C <u>Applications:-</u>

Used for a.c. applications.

## Materials used for potentiometer

2. Hot Moulded Carbon:-The resistance element is fabricated by moulding together a mixture of carbon & a thermosetting plastic binder

<u>Applications:-</u>

Used for a.c. applications.

3. Carbon Film:- A very thin film of carbon deposited on a non-conductive base forms the resistance element.

#### <u>Advatages :</u>

Low Cost.

Temperature Co-efficient are upto 100\*10<sup>-6</sup>/°C

4. Thin Metal Film:-A very thin, vapour deposited layer of metal on glass or ceramic is used as resistance element.

#### <u>Advatages :</u>

- 1. Its excellent resistance to changes in environments
- 2.Used for a.c. applications
- 3.Cost is also moderate

# Advatages and Disadvantages of resistance potentiometer

#### Advatages:-

- They are inexpensive.
- They are simple to operate.
- They are very useful for measurement of large amplitudes of displacement.
- Their electrical efficiency is very high & they provide sufficient o/p to permit control operations without further amplification.
- It should be understood that while the frequency response of wire wound potentiometers is limited.
- In wire wound potentiometers the resolution is limited while in cermet & metal film the resolution is infinite.

#### Disadvantages:-

- Linear potentiometer requires a large force to move their sliding contacts.
- The other problem with sliding contacts are that they can be contaminated ,can wear out,become misaligned & generate noise. so life is limited.

### Strain

**Strain** is the geometrical expression of deformation caused by the action of **stress** on a physical body. Strain is calculated by first assuming a change between two body states: the beginning state and the final state. Then the difference in placement of two points in this body in those two states expresses the numerical value of strain. Strain therefore expresses itself as a change in size and/or shape.

### Strain Gauges

- If a metal conductor is stretched or compressed ,its resistance changes on account of the fact that both length and diameter of conductor change.also there is a change in the value of resistivity of the conductor when it is strained and this property is called piezoresistive effect.
- Resistance strain gauges are also called piezoresistive gauges.

### Strain gauge – the gauge factor

•  $G_f = \Delta R/R / \Delta L/L$ 

R = the initial resistance in ohms (without strain)  $\Delta R$  = the change of initial resistance in ohms L = the initial length in meters (without strain)  $\Delta L$  = the change of initial length in meters

 The poisson's ratio for all metals is between 0 and 0.5.This gives a gauge factor of approximately ,2.


## Strain gauge – contd.....

 A resistance wire strain gauge uses a soft iron wire of small diameter.The gauge factor is +4.2.Neglecting the piezoresistive effects,calculate the poisson's ratio.

• Ans:1.6

## Types of strain gauges

- Unbonded metal strain gauges
- Bonded metal wire strain gauges.
- Bonded metal foil strain gauges.
- Vacuum deposited thin metal film strain gauges.
- Sputter deposited thin metal strain gauges.
- Bonded semiconductor strain gauges.
- Diffused metal strain gauges.

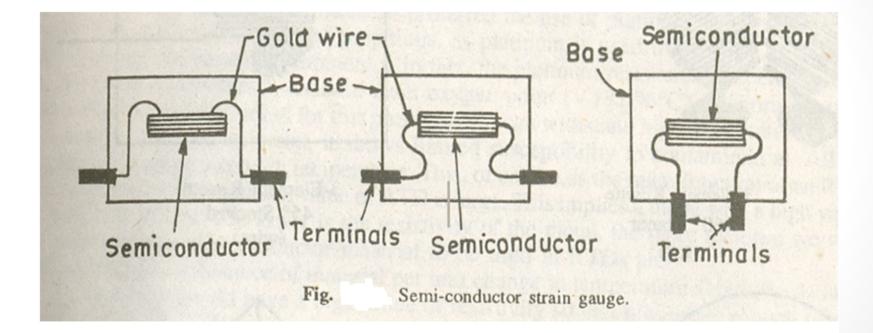


- These gauges are used where a very high gauge factor is required.
- The resistance of the semiconductors changes with change in applied strain.
- The semiconductor strain gauge depend for their action upon piezo-resistive effect, i.e the change in the value of the resistance due to change in resistivity.

- Si and Ge are used as resistive materials for semiconductor strain gauges.
- A typical strain gauge consists of a strain sensitive crystal material and leads that are sandwiched in a protective matrix.
- The production of these gauges employs conventional semiconductor technology.

• Advantages :-

They have high gauge factor of about  $\pm 130$ .

- This allows measurement of very small strains of order of .01 microstrain.
- Hystersis characteristics of these gauges are excellent.
- Fatigue life is in excess and frequency response is upto 10<sup>12</sup> Hz.

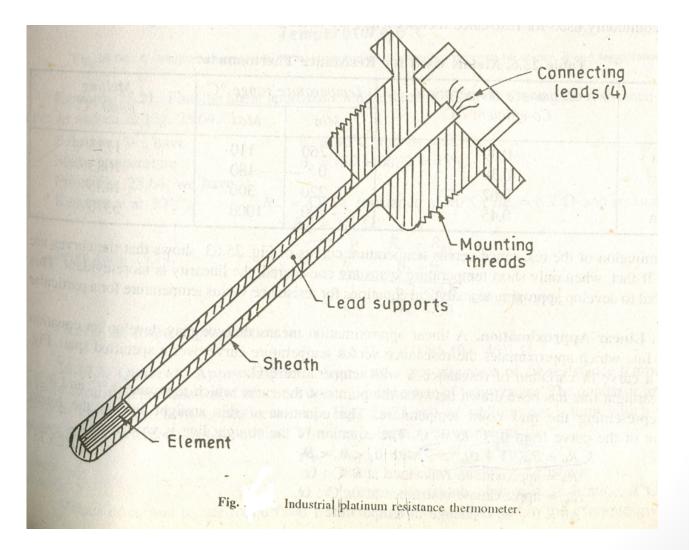


- In RTD, the resistance of a conductor changes when its temperature is changed.
- $R = R_0 (1 + \alpha_1 T + \alpha_2 T^2 + ... \alpha_n T^n + ...)$
- Where  $R_0$ =resistance at temperature T=0 and  $\alpha_1, \alpha_2, \dots, \alpha_n$  are constants.
- Platinum is especially suited for this purpose, it can withstand high temperatures while maintaining excellent stability.

- All metals produce a positive change in resistance with temperature.
- The requirements of a conductor material to be used in RTDs are:-
- The change in resistance of material per unit change in temperature should be as large as possible.
- The material should have a high value of resistivity so that minimum volume of material is used for the construction of RTD.

The resistance of materials should have a continuous and stable relationship with temperature.

### Characteristics of Resistance Thermometers

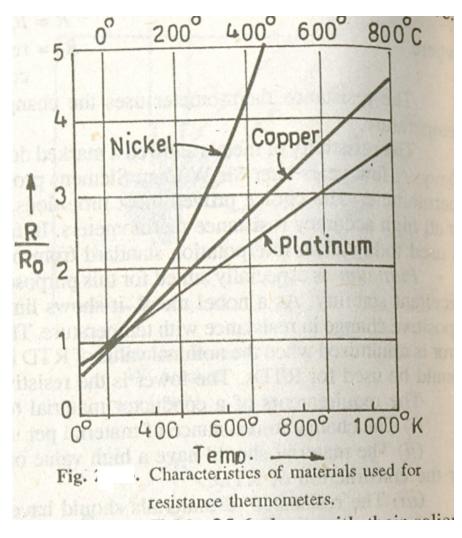

### Metals used for RTDs


Metal	Resistance temperature Co-efficient /°C	Temperature range °C		Melting point °C
		Min	Max	point C.
Platinum Copper Nickel Tungsten	0.39 0.39 0.62 0.45	- 260 0 - 220 - 200	110 180 300 1000	1773 1083 1435 3370


### Assignment

Q.Explain the working principle of RTD and also draw characteristics for the same.

- These are composed of semiconducting materials.
- Because of negative temperature coefficients of thermistors, they can detect very small change in temperature which could not be possible with RTDs or thermocouples.
- High sensitivity to temperature, it will be useful for precision temperature measurements control and compensation.

- It can measure temperature from -60°C to 15°C.
- Resistance of thermistor range from 0.5 ohm to 0.75 ohm.
- Thermistor exhibits a highly nonlinear characteristics of resistance versus temperature.

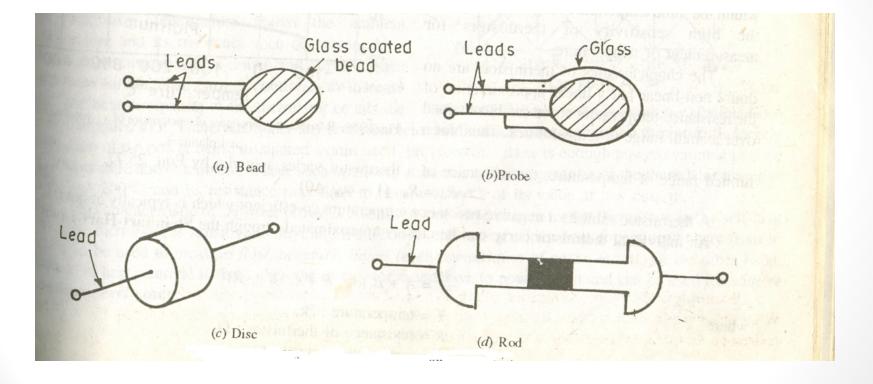

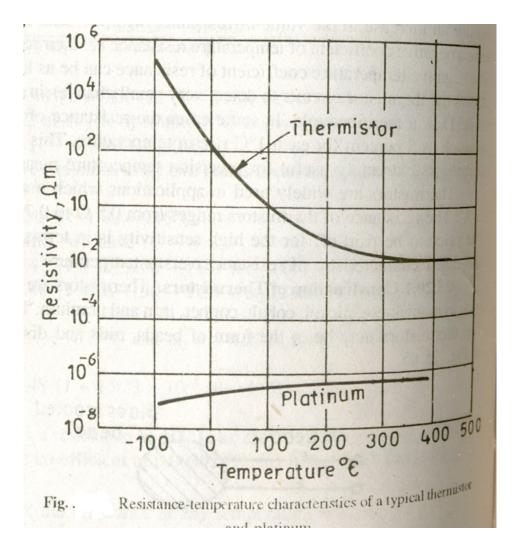

# Resistance temperature characteristics of Thermistors

- $R_{T1} = R_{T2} \exp[\beta\{(1/T_1) (1/T_2)\}]$
- Where R<sub>T1</sub>=reistance of the thermistor at absolute temperature T<sub>1</sub>;<sup>0</sup>K
- R<sub>T2</sub>=reistance of the thermistor at absolute temperature T<sub>2</sub>;<sup>0</sup>K
- β = a constant depending upon the material of thermistor, typically 3500 to 4500 °K.

- An individual thermistor curve can be closely approximated through the Steinhart-Hart equation:
- $1/T=A + B \log_e R + C(\log_e R)^3$

Where T=temperature :<sup>0</sup>K, R=resistance of thermistor;Ω A,B,C=curve fitting constants. T=(B/logeR-A)- C

## **Applications of Thermistors**

- Measurement of temperature.
- Control of temperature.
- Temperature compensation.
- Measurement of power at high frequencies.
- Measurement of thermal conductivity.
- Measurement of level, flow and pressure of liquids.
- Measurement of composition of gases.
- Vacuum measurements and
- Providing time delays.

### Thermocouples

- What Is A Thermocouple Sensor??
- Basic Working Principle
- Practical Thermocouple Construction
- Thermocouple Materials
- Standard Thermocouple Types
- Thermocouple Color Codes
- Characteristics
- Major Specifications
- Capabilities and Limitations
- Selecting A Temperature Sensor
- Comparisons

#### What Is A Thermocouple Sensor??

Thermocouples are among the easiest temperature sensors to use and obtain and are widely used in science and industry.

Thermocouples are the most common temperature sensing device. They can be made in very tough designs, they are very simple in operation and measure temperature at a point. Over different types they cover from -250C to +2500C.

Accurate temperature measurements can be made with thermocouples sensors at low cost with shop-built probes and ordinary low-level voltmeters.

#### **Basic Working Principle**


The principle of operation is on the Seebeck effect. A temperature gradient along a conductor creates an EMF. If two conductors of different materials are joined at one point, an EMF is created between the open ends which is dependent upon the temperature of the junction. As T1 increases, so does V. The EMF also depends on the temperature of the open ends T2.



The junction is placed in the process, the other end is in iced water at 0C. This is called the reference junction.

#### Practical Thermocouple Construction

A thermocouple construction consist of two conductors, welded together at the measuring point and insulated from each other long the length. It will usually have an outer protection sheath.

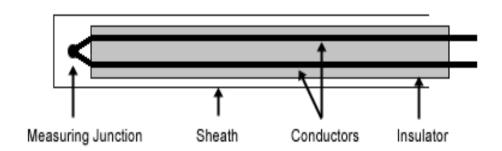

#### **Thermocouple Materials**

The three most common thermocouple materials for moderate temperatures are Iron-Constantan (Type J), Copper-Constantan (Type T), and Chromel-Alumel (Type K).

1-) The first named element of the pair is the positive element.

2-) The negative wire is color coded red.


All three types (J, K, and T) are available as insulated duplexed pairs from 0.001-inch diameter on up. For accuracy, and minimum system disturbance, the smaller the wire the better, but wire smaller than 0.003-inch diameter is very fragile.

### Displacement transducers

- Capacitive transducer
- Inductive transducer
- Variable inductance transducer

### Capacitive transducers

• The capacitance of a parallel-plate capacitor is given by

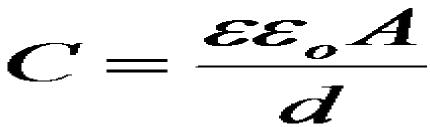


 $\varepsilon$  = dielectric constant

 $\varepsilon_o = 8.854 \text{ x } 10^{-12}$ , in farad per meter

- A = the area of the plate, in square meter
- *d* = the plate spacing in meters


### Capacitive transducers

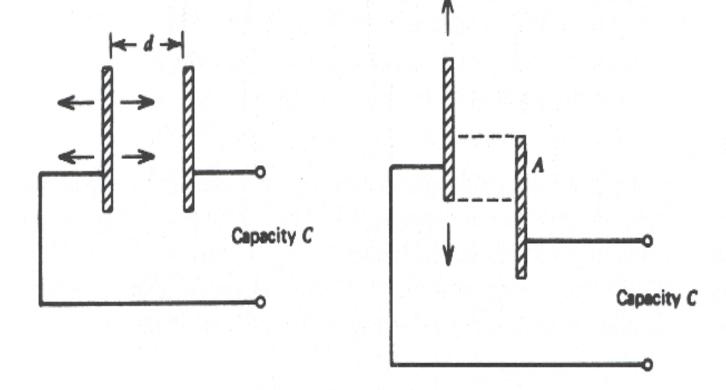


Capacity varies with the distance between the plates and the common area. Both effects are used in sensors.

# LVDT (Linear Variable Differential Transformer)


#### Construction

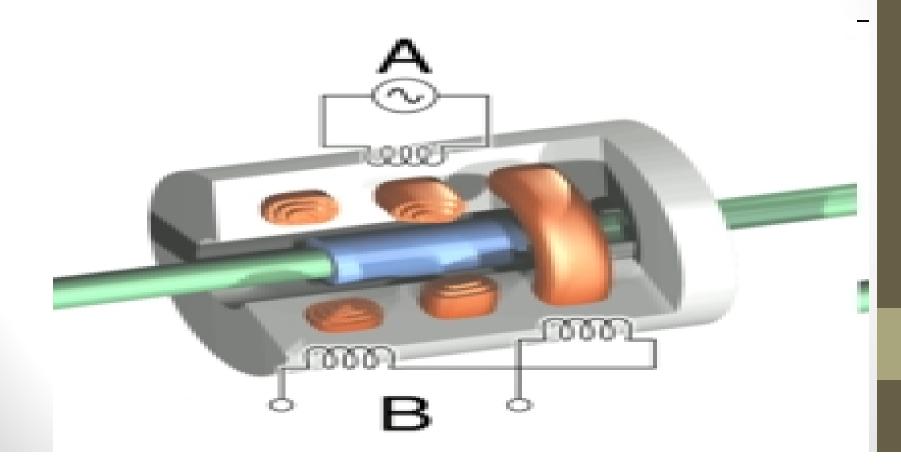

## LVDT Working

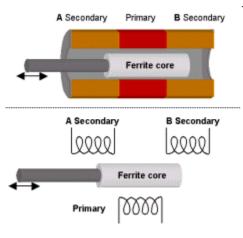

# LVDT Working

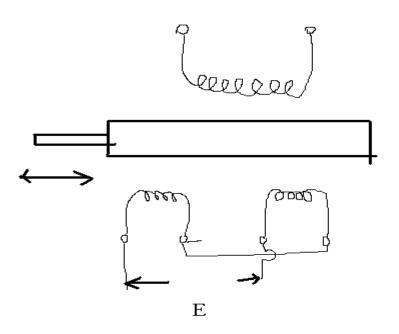



# Linear Variable Differential Transducer (LVDT)

- The most widely used inductive transducer to translate the linear motion into electrical signals is the Linear variable differential transducer(LVDT).
- The assembly is placed in stainless steel housing & the end lids provide electrostatic & electromagnetic shielding.
- The frequency of a.c.applied to primary winding is b/w 50Hz to 20KHz.
- The o/p voltage of secondary,  $S_1$  is  $E_{S1}$  and that of secondary,  $S_2$  is  $E_{S2}$ .
- In order to convert the o/p from S<sub>1</sub> and S<sub>2</sub> into a single voltage signal, the two secondaries S<sub>1</sub> and S<sub>2</sub> are connected in series. Thus the o/p voltage of the transducer is the difference of two voltages.

Differential o/p voltage ,

$$E_{o} = E_{S1} - E_{S2}$$

When the core is at its normal position the flux linking with both the secondary windings is given as:

$$\mathsf{E}_{\mathsf{S1}}=\mathsf{E}_{\mathsf{S2}}$$

Linear Variable Differential Transducer(LVDT) contd.....

 Now if the core is moved to the Left of the Null position the magnitude of the o/p voltage is given by:


$$E_{o} = E_{S1} - E_{S2}$$

 Now if the core is moved to the Right of the Null position the magnitude of the o/p voltage is given by:

$$\mathsf{E}_{\mathsf{o}} = \mathsf{E}_{\mathsf{S2}} - \mathsf{E}_{\mathsf{S1}}$$

& it is 180° out of phase & negative with the primary voltage.

### Displacement Vs O/p V

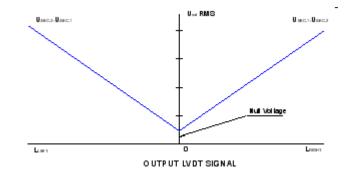

## Advantages of LVDT

#### 1. High Range:

- For measurement of displacement ranging from 1.25 mm to 250 mm.
- .025 % of linearity.

#### 2. Friction and Electrical Isolation:

- There is no physical contact b/w the movable core & coil structure which means that the L.V.D.T is a frictionless device
- The absence of friction b/w coil & core of an L.V.D.T means that there is no wear out. This gives an L.V.D.T essentially infinite mechanical life.
- The infinite mechanical life is also important for high reliability mechanisms and systems.
- System found applications in space vehicles, aircrafts, missiles & critical industrial equipment.
- The frictionless operation combined with induction principle can respond to even minute motion of the core & produce an output.

## Advantages of LVDT

#### 3.High input & high sensitivity:

- The L.VD.T gives a high o/p and many times there is no need for amplification
- The transducer has high sensitivity which is typically about 40v/mm.

#### 4.Ruggedness:

- These transducer can usually tolerate high degree of shock and vibrations especially when the core is spring loaded without any adverse effects.
- They are simple in construction and by virtue of their being small and light in weight, they are easy to align and maintain.
- 5.Low Hysteresis: L.V.D.T show a low hence hysteresis & repeatability is excellent under all conditions.
- **<u>6.Low Power Consumption</u>**: Most of L.V.D.T consume which is less than 1W.

### Disadvantages of LVDT

- 1.Relatively large displacements are required for appreciable differential o/p.
- 2.They are sensitive to stray magnetic fields but shielding is possible. This is done by providing magnetic shields with longitudinal slots.
- 3. Many times , the transducer performance is affected by vibrations

4.Temp.affects the performance of the transducer.