# **Control Systems**



## **Topics Covered**

- Pole zero transfer function
- Bode plot

## Poles and Zeros and Transfer Functions

**Transfer Function:** 

A transfer function is defined as the ratio of the Laplace transform of the output to the input with all initial conditions equal to zero. Transfer functions are defined only for linear time invariant systems.

**Considerations**:

Transfer functions can usually be expressed as the ratio of two polynomials in the complex variable, s.

**Factorization:** 

A transfer function can be factored into the following form.

$$G(s) = \frac{K(s+z_1)(s+z_2)...(s+z_m)}{(s+p_1)(s+p_2)...(s+p_m)}$$

The roots of the numerator polynomial are called zeros.


The roots of the denominator polynomial are called poles.

### Poles, Zeros and the S-Plane

An Example:

You are given the following transfer function. Show the poles and zeros in the s-plane.

 $G(s) = \frac{(s+8)(s+14)}{s(s+4)(s+10)}$ 

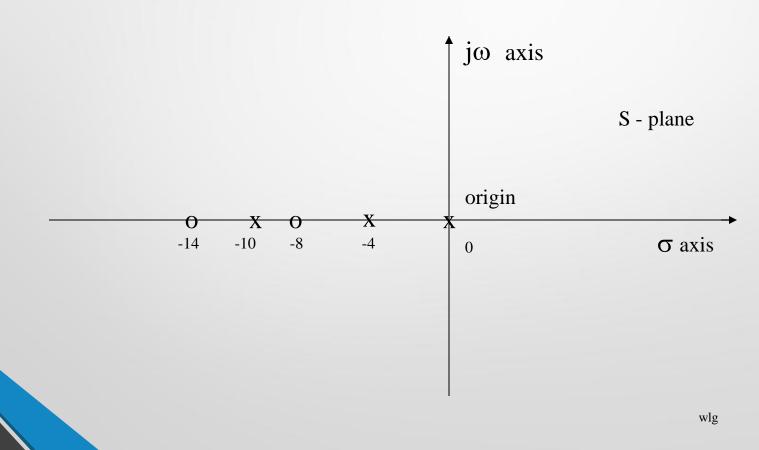

#### **Characterization:**

Considering the transfer function of the previous slide. We note that we have 4 different types of terms in the previous general form: These are:

$$K_{_{B}}, \frac{1}{s}, \frac{1}{(s/p + 1)}, (s/z + 1)$$

Expressing in dB:

Given the tranfer function:

 $G(jw) = \frac{K_{B}(jw/z+1)}{(jw)(jw/p+1)}$ 

 $20\log |G(jw|=20\log K_{B}+20\log |(jw/z+1)|-20\log |jw|-20\log |jw/p+1|$ 

Mechanics:


We have 4 distinct terms to consider:

20logK<sub>B</sub>

 $20\log|(jw/z + 1)|$ 

-20log|jw|


 $-20\log|(jw/p + 1)|$ 

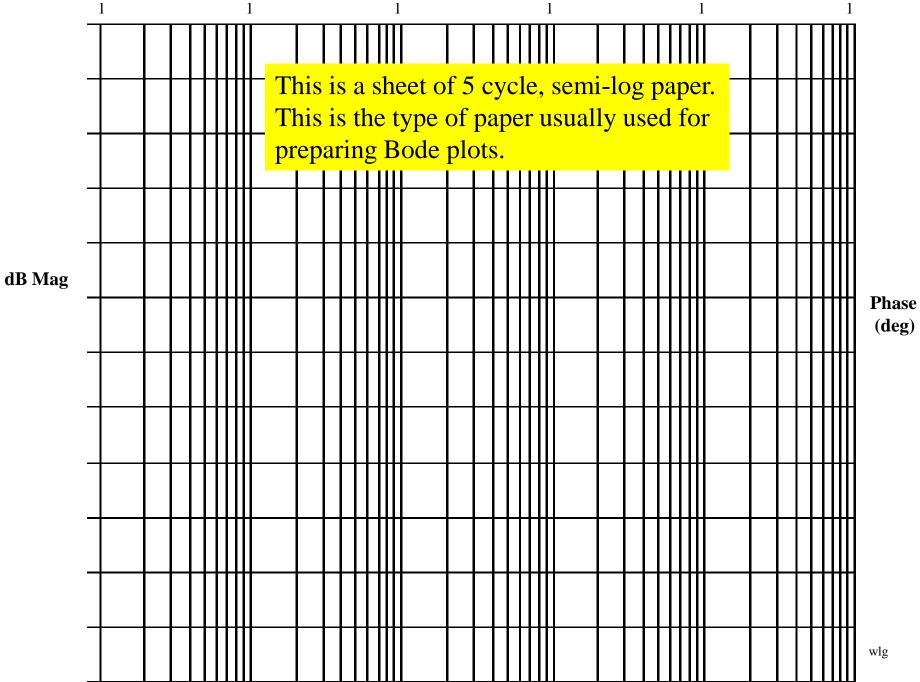

Mechanics:


The gain term,  $20\log K_{B_i}$  is just so many dB and this is a straight line on Bode paper, independent of omega (radian frequency).

The term,  $-20\log|jw| = -20\log w$ , when plotted on semi-log paper is a straight line sloping at -20dB/decade. It has a magnitude of 0 at w = 1.

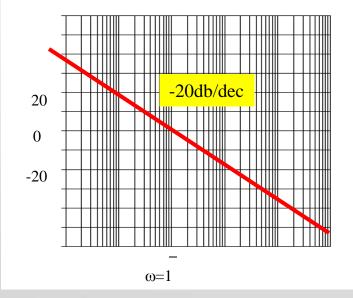

Mechanics:

The term,  $-20\log|(jw/p + 1)$ , is drawn with the following approximation: If w -20\log|(jw/p + 1)| = 0 dB, a flat line on the Bode. If w > p we use the approximation of  $-20\log(w/p)$ , which slopes at -20dB/dec starting at w = p. Illustrated below. It is easy to show that the plot has an error of -3dB at w = p and -1 dB at w = p/2 and w = 2p. One can easily make these corrections if it is appropriate.

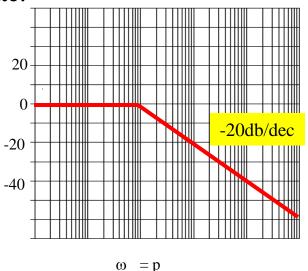

#### Mechanics:

When we have a term of  $20\log|(jw/z + 1)|$  we approximate it be a straight line of slop 0 dB/dec when w < z. We approximate it as  $20\log(w/z)$ when w > z, which is a straight line on Bode paper with a slope of + 20dB/dec. Illustrated below.



 $\omega = z$ 

## Example 1:

Given:

$$G(jw) = \frac{50,000(jw+10)}{(jw+1)(jw+500)}$$

<u>First</u>: <u>Always</u>, <u>always</u>, <u>always</u> get the poles and zeros in a form such that the constants are associated with the jw terms. In the above example we do this by factoring out the 10 in the numerator and the 500 in the denominator.

$$G(jw) = \frac{50,000x10(jw/10+1)}{500(jw+1)(jw/500+1)} = \frac{100(jw/10+1)}{(jw+1)(jw/500+1)}$$

<u>Second</u>: When you have neither poles nor zeros at 0, start the Bode at  $20\log_{10}K = 20\log_{10}100 = 40$  dB in this case.

## Example 1:

### (continued)


Third:Observe the order in which the poles and zeros occur.<br/>This is the secret of being able to quickly sketch the Bode.<br/>In this example we first have a pole occurring at 1 which<br/>causes the Bode to break at 1 and slope -20 dB/dec.<br/>Next, we see a zero occurs at 10 and this causes a<br/>slope of +20 dB/dec which cancels out the -20 dB/dec,<br/>resulting in a flat line (0 db/dec). Finally, we have a<br/>pole that occurs at w = 500 which causes the Bode<br/>to slope down at -20 dB/dec.

We are now ready to draw the Bode.

Before we draw the Bode we should observe the range over which the transfer function has active poles and zeros. This determines the scale we pick for the w (rad/sec) at the bottom of the Bode.

The dB scale depends on the magnitude of the plot and experience is the best teacher here.

Bode Plot Magnitude for 100(1 + jw/10)/(1 + jw/1)(1 + jw/500)

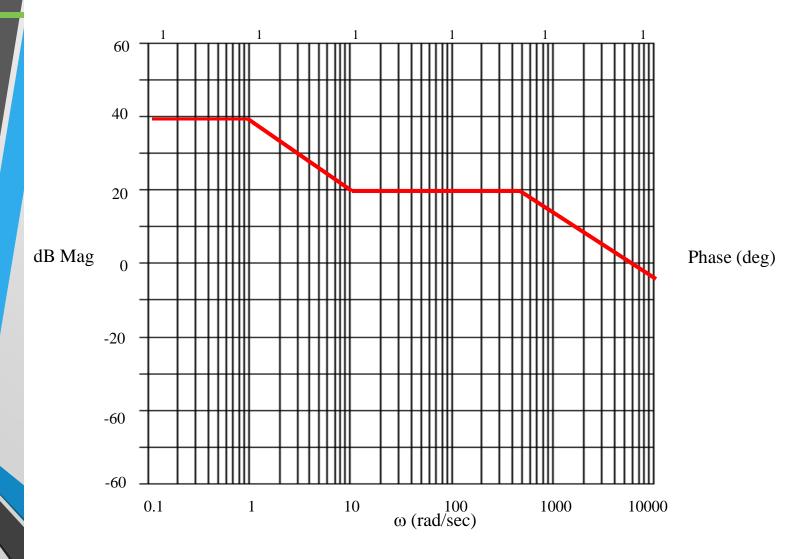

## Phase for Bode Plots

<u>Comment</u>: Generally, the phase for a Bode plot is not as easy to draw or approximate as the magnitude. In this course we will use an analytical method for determining the phase if we want to make a sketch of the phase.

<u>Illustration</u>: Consider the transfer function of the previous example. We express the angle as follows:

 $\angle G(jw) = \tan^{-1}(w/10) - \tan^{-1}(w/1) - \tan^{-1}(w/500)$ 

We are essentially taking the angle of each pole and zero. Each of these are expressed as the tan<sup>-1</sup>(j part/real part)

Usually, about 10 to 15 calculations are sufficient to determine a good idea of what is happening to the phase.

Example 2:

dB

Given the transfer function. Plot the Bode magnitude.

 $G(s) = \frac{100(1+s/10)}{s(1+s/100)^2}$ 

Consider first only the two terms of

 $\frac{100}{jw}$ 


Which, when expressed in dB, are;  $20\log 100 - 20 \log w$ . This is plotted below.


Example 2: (continued) The completed plot is shown below.  $G(s) = \frac{100(1+s/10)}{s(1+s/100)^2}$ 1 1 1 60 -20db/dec 40 20 Phase (deg) -40 db/dec 0 -20  $G(s) = \frac{100(1+s/10)}{s(1+s/100)^2}$ -40 -60 0.1 10 100 1000 1


 $\omega$  (rad/sec)

dB Mag


wlg

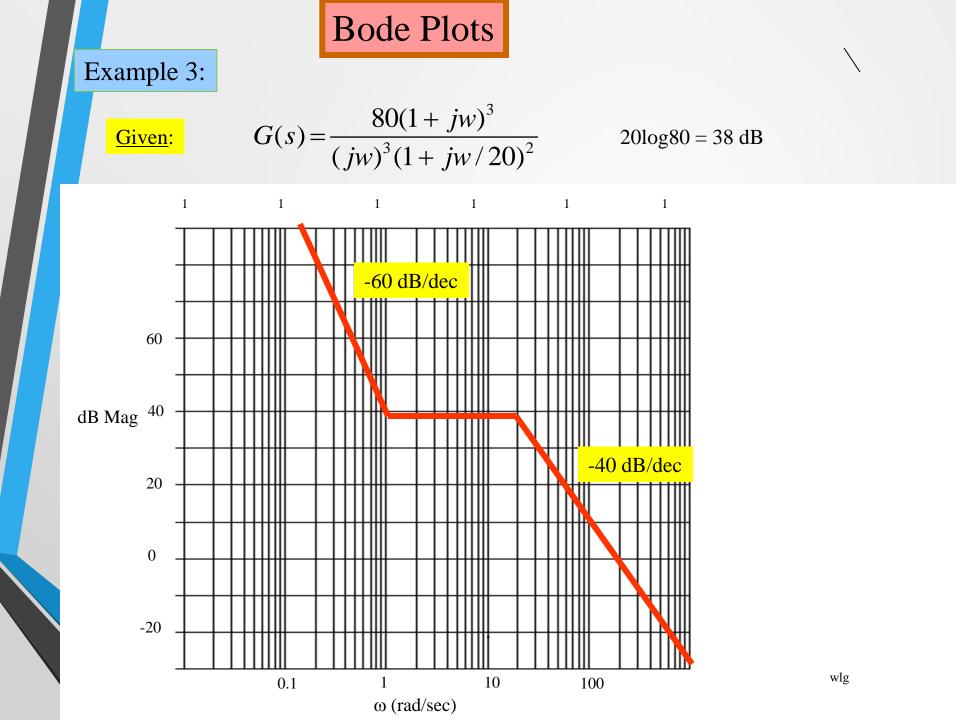


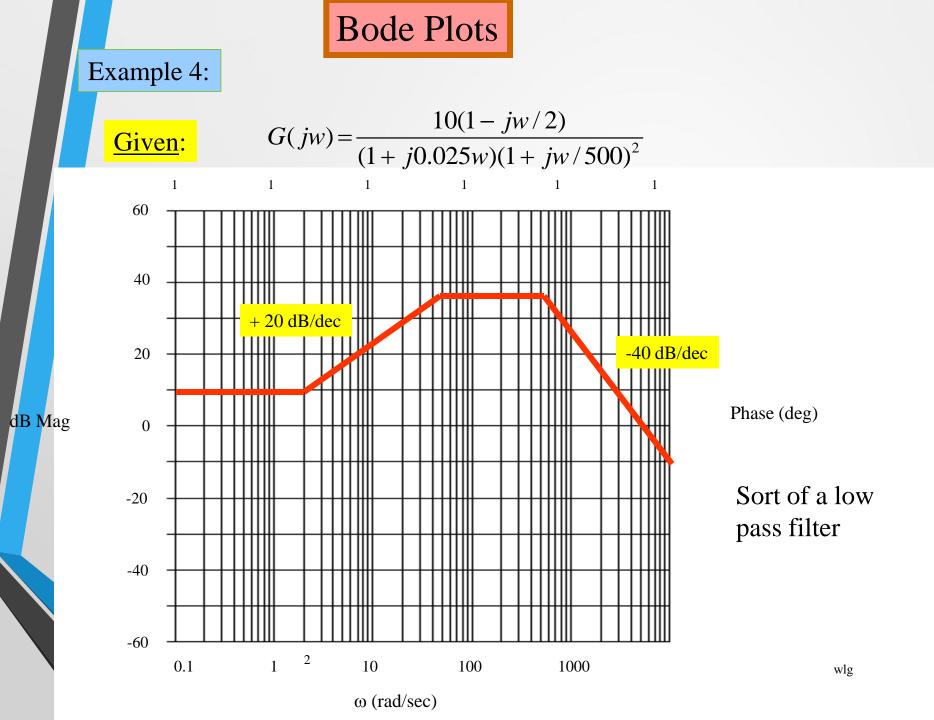

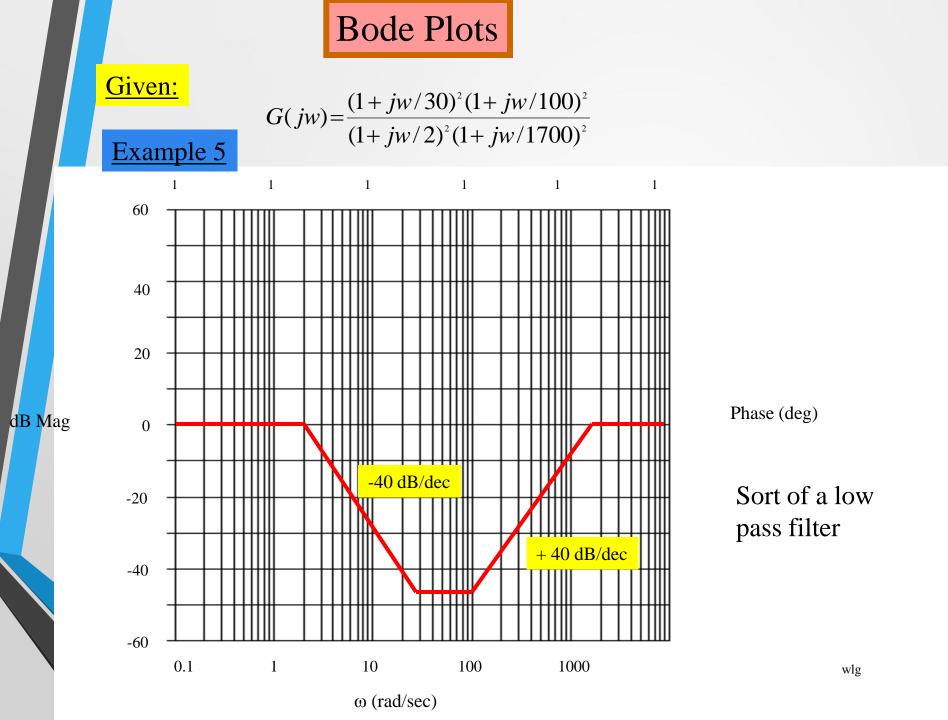





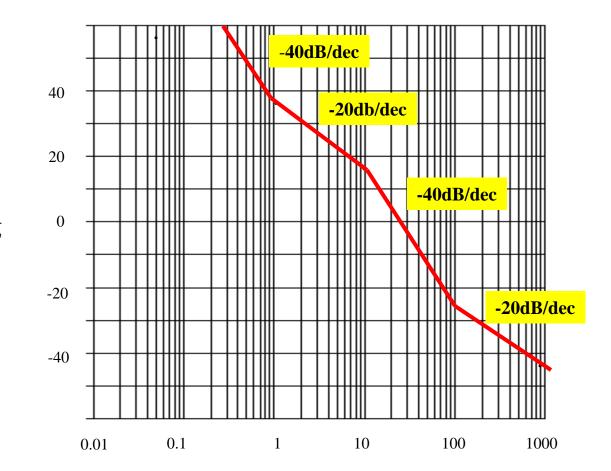


dB mag



Design Problem:

Design a G(s) that has the following Bode plot.

#### Example 7

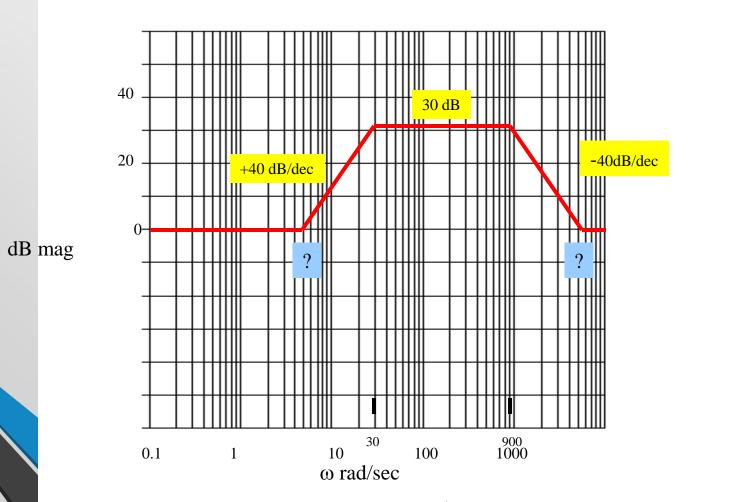

wlg

**Procedure:** The two break frequencies need to be found. Recall:

 $#dec = log_{10}[w_2/w_1]$ 

Then we have:

(#dec)(40dB/dec) = 30 dB

 $\log_{10}[w_1/30] = 0.75$   $\longrightarrow$   $w_1 = 5.33 \text{ rad/sec}$ 

#### Also:

 $\log_{10}[w_2/900]$  (-40dB/dec) = - 30dB

This gives  $\underline{w}_2 = 5060 \text{ rad/sec}$