

Introduction to CMOS VLSI Design


CMOS Fabrication

CMOS Fabrication

- ❑ CMOS transistors are fabricated on silicon wafer
- ❑ Lithography process similar to printing press
- ❑ On each step, different materials are deposited or etched
- ❑ Easiest to understand by viewing both top and cross-section of wafer in a simplified manufacturing process


Inverter Cross-section

- ❑ Typically use p-type substrate for nMOS transistors
- ❑ Requires n-well for body of pMOS transistors

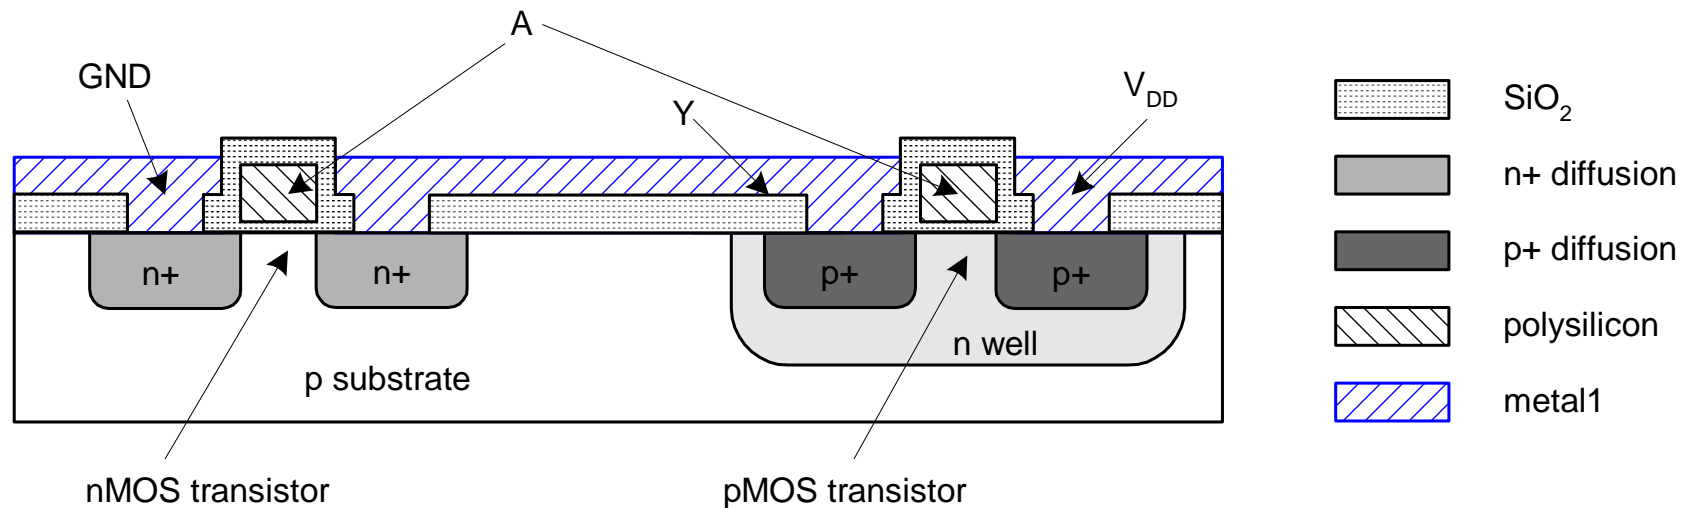


Well and Substrate Taps

- ❑ Substrate must be tied to GND and n-well to V_{DD}
- ❑ Metal to lightly-doped semiconductor forms poor connection called Schottky Diode
- ❑ Use heavily doped well and substrate contacts / taps

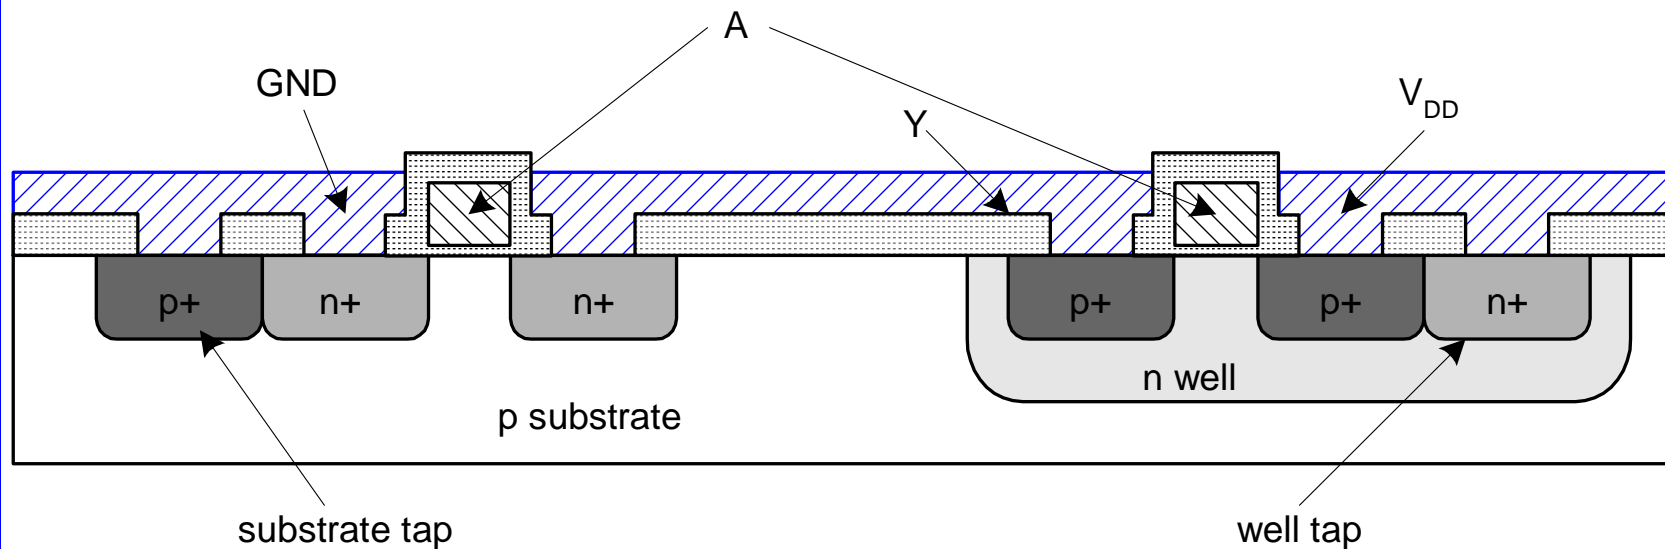


Inverter Mask Set

- ❑ Transistors and wires are defined by *masks*
- ❑ Cross-section taken along dashed line

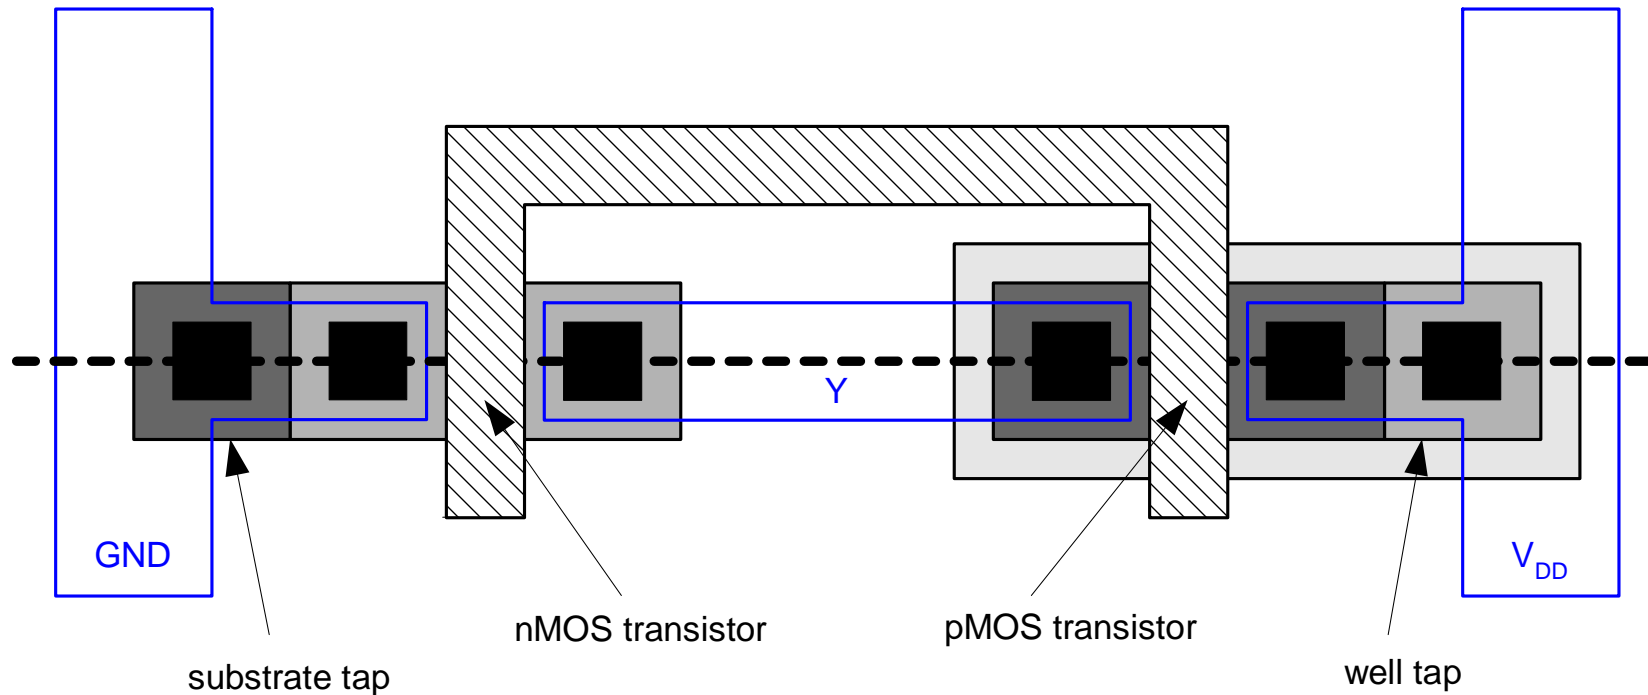

Detailed Mask Views

- Six masks
 - n-well
 - Polysilicon
 - n+ diffusion
 - p+ diffusion
 - Contact
 - Metal

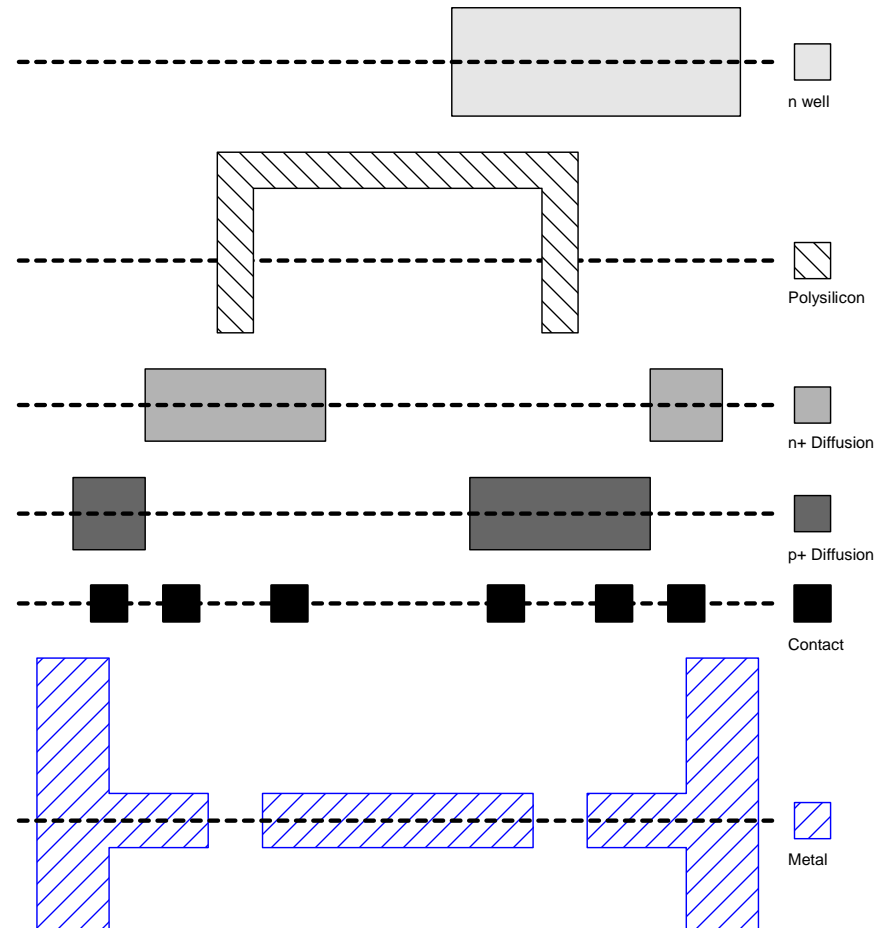

Fabrication Steps

- ❑ Start with blank wafer
- ❑ Build inverter from the bottom up
- ❑ First step will be to form the n-well
 - Cover wafer with protective layer of SiO_2 (oxide)
 - Remove layer where n-well should be built
 - Implant or diffuse n dopants into exposed wafer
 - Strip off SiO_2



p substrate


Oxidation

- Grow SiO_2 on top of Si wafer
 - 900 – 1200 C with H_2O or O_2 in oxidation furnace




Photoresist

- Spin on photoresist
 - Photoresist is a light-sensitive organic polymer
 - Softens where exposed to light

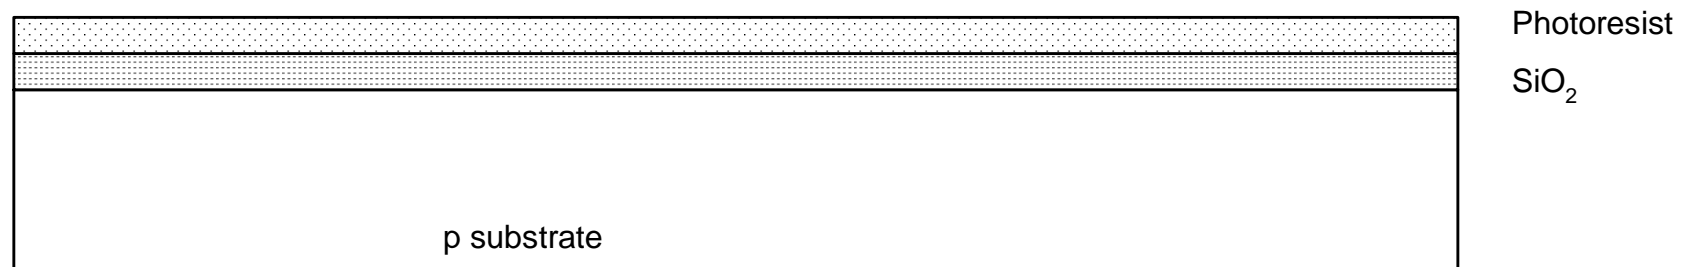


Lithography

- ❑ Expose photoresist through n-well mask
- ❑ Strip off exposed photoresist

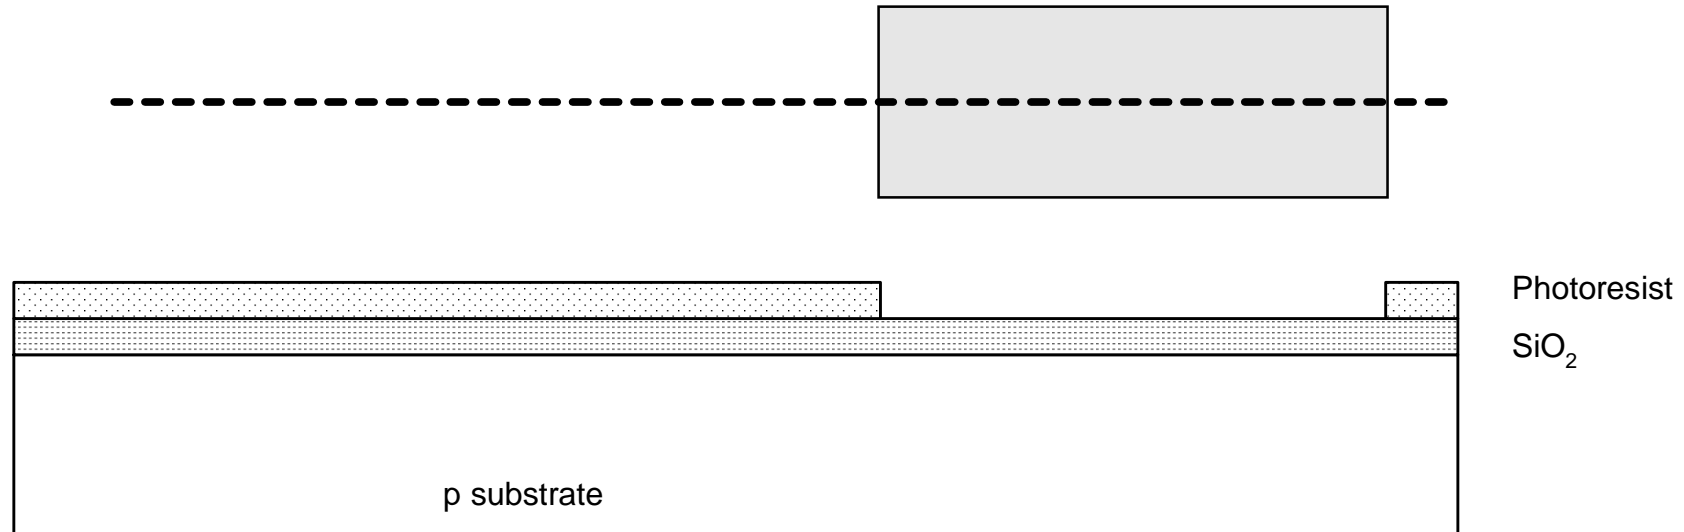


Etch

- ❑ Etch oxide with hydrofluoric acid (HF)
 - Seeps through skin and eats bone; nasty stuff!!!
- ❑ Only attacks oxide where resist has been exposed

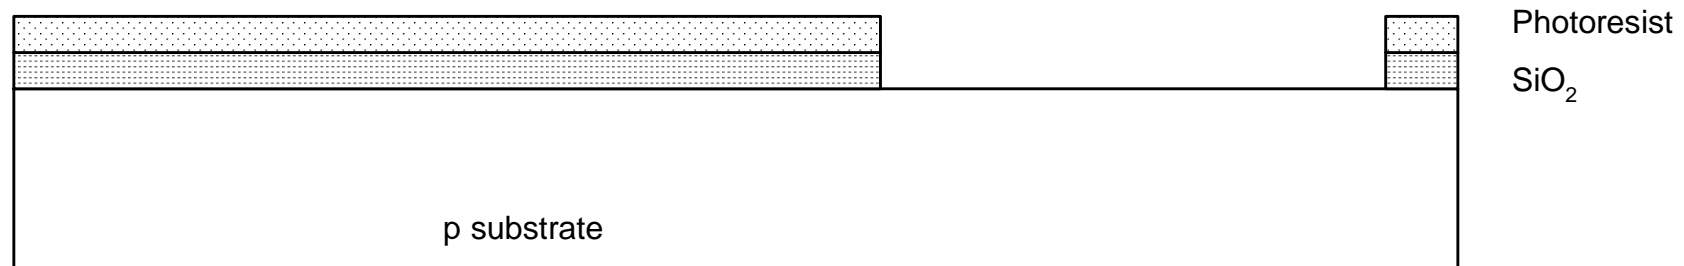


Strip Photoresist

- ❑ Strip off remaining photoresist
 - Use mixture of acids called piranah etch
- ❑ Necessary so resist doesn't melt in next step

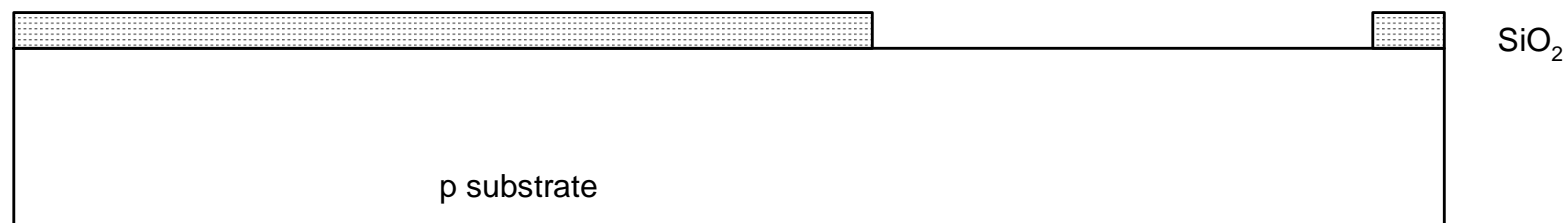


n-well

- ❑ n-well is formed with diffusion or ion implantation
- ❑ Diffusion
 - Place wafer in furnace with arsenic gas
 - Heat until As atoms diffuse into exposed Si
- ❑ Ion Implantation
 - Blast wafer with beam of As ions
 - Ions blocked by SiO_2 , only enter exposed Si

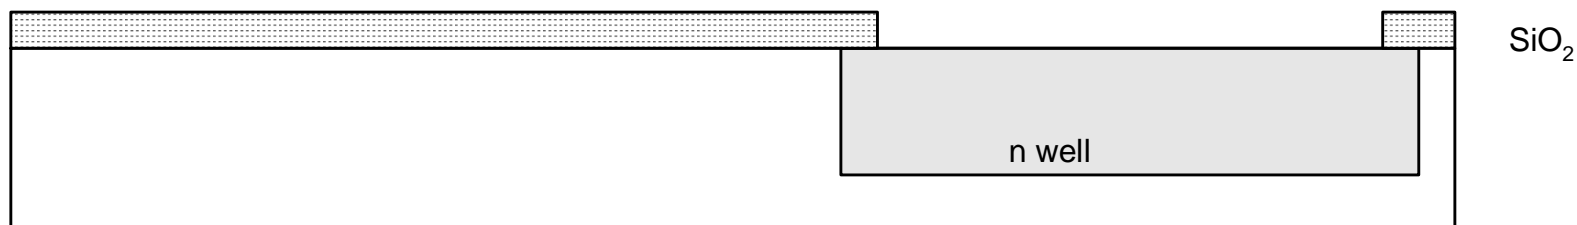


Strip Oxide

- ❑ Strip off the remaining oxide using HF
- ❑ Back to bare wafer with n-well
- ❑ Subsequent steps involve similar series of steps

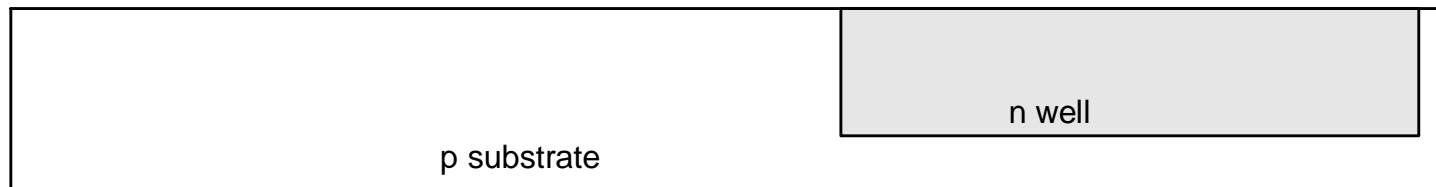


Polysilicon

- ❑ Deposit very thin layer of gate oxide
 - $< 20 \text{ \AA}$ (6-7 atomic layers)
- ❑ Chemical Vapor Deposition (CVD) of silicon layer
 - Place wafer in furnace with Silane gas (SiH_4)
 - Forms many small crystals called polysilicon
 - Heavily doped to be good conductor

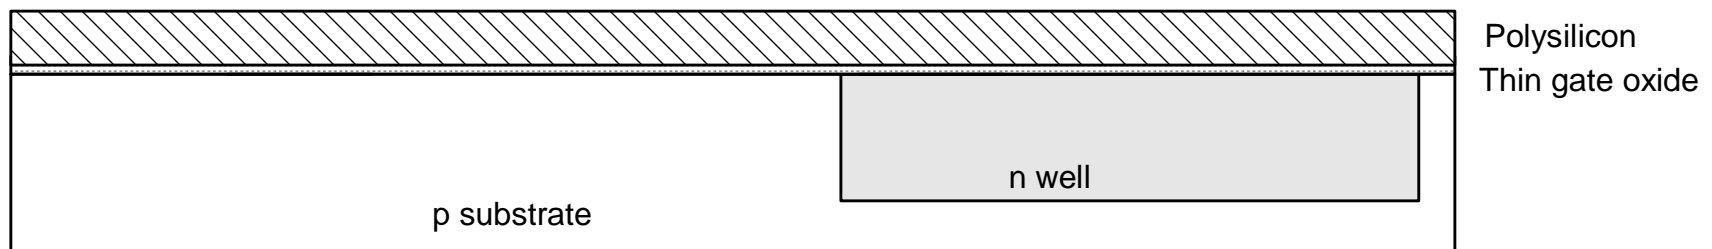


Polysilicon Patterning

- ❑ Use same lithography process to pattern polysilicon

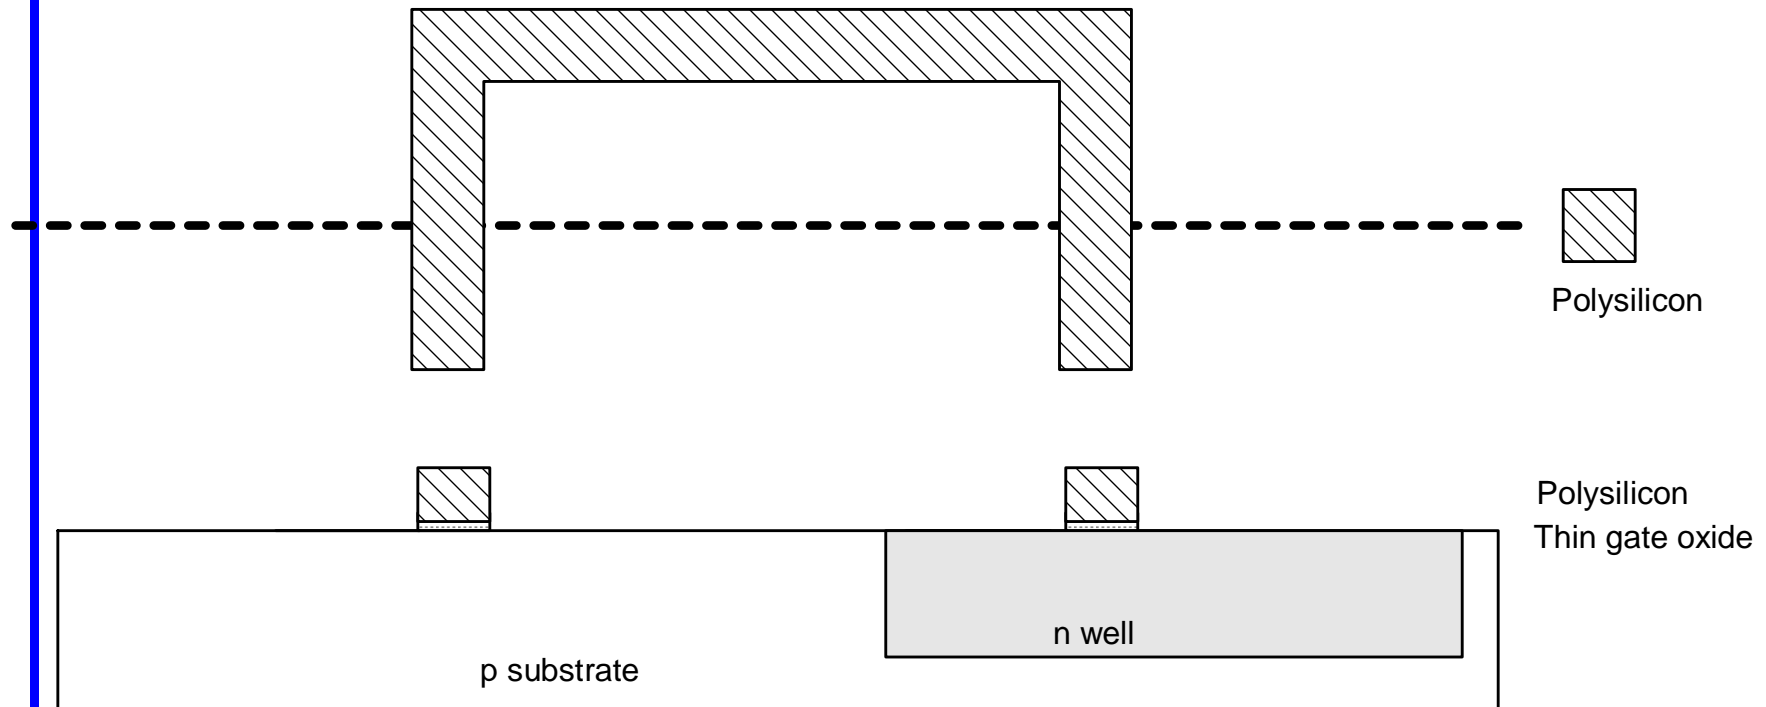


Self-Aligned Process

- ❑ Use oxide and masking to expose where n+ dopants should be diffused or implanted
- ❑ N-diffusion forms nMOS source, drain, and n-well contact

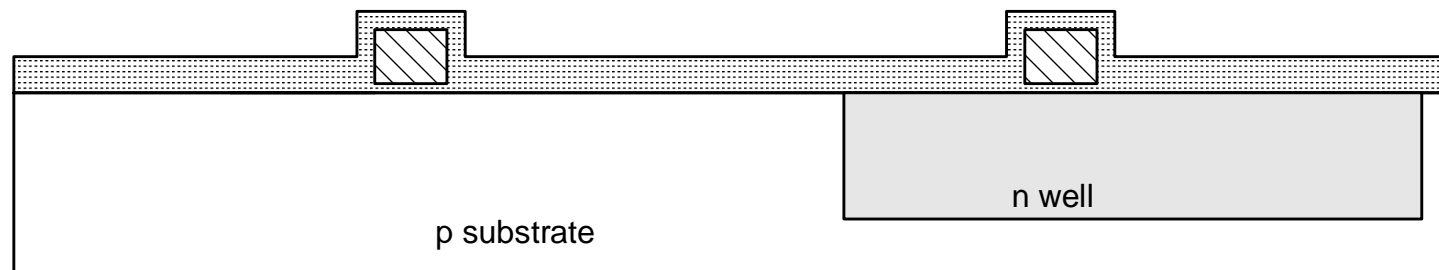


N-diffusion

- ❑ Pattern oxide and form n+ regions
- ❑ *Self-aligned process* where gate blocks diffusion
- ❑ Polysilicon is better than metal for self-aligned gates because it doesn't melt during later processing

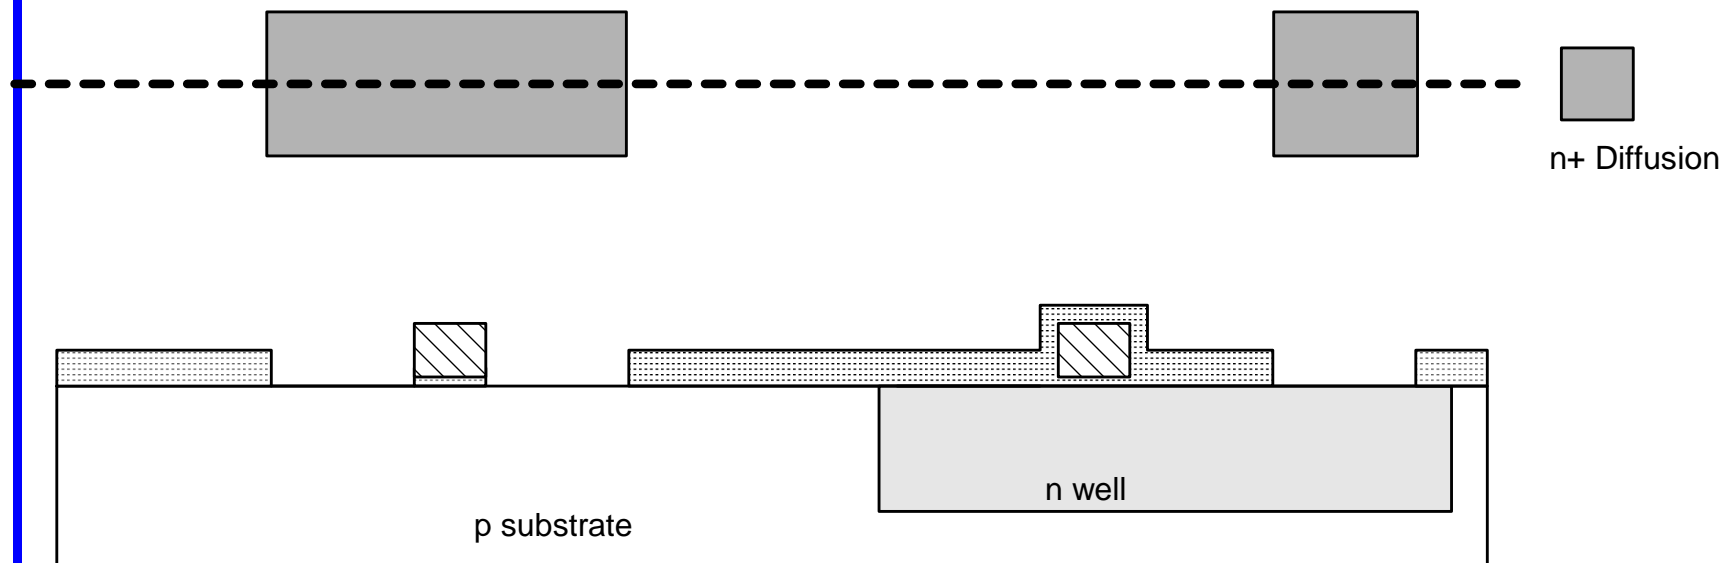


N-diffusion cont.

- ❑ Historically dopants were diffused
- ❑ Usually ion implantation today
- ❑ But regions are still called diffusion

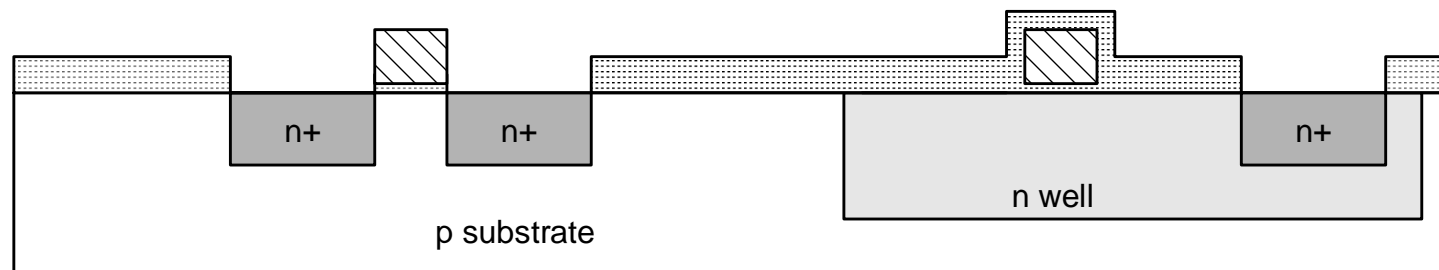


N-diffusion cont.

- Strip off oxide to complete patterning step

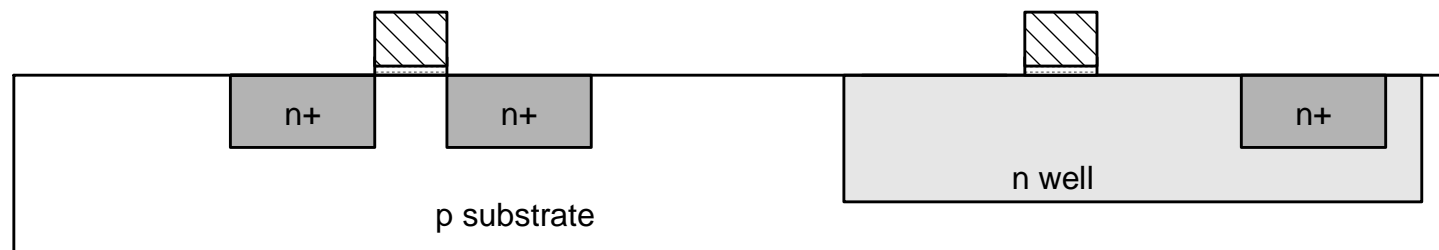


P-Diffusion

- Similar set of steps form p+ diffusion regions for pMOS source and drain and substrate contact

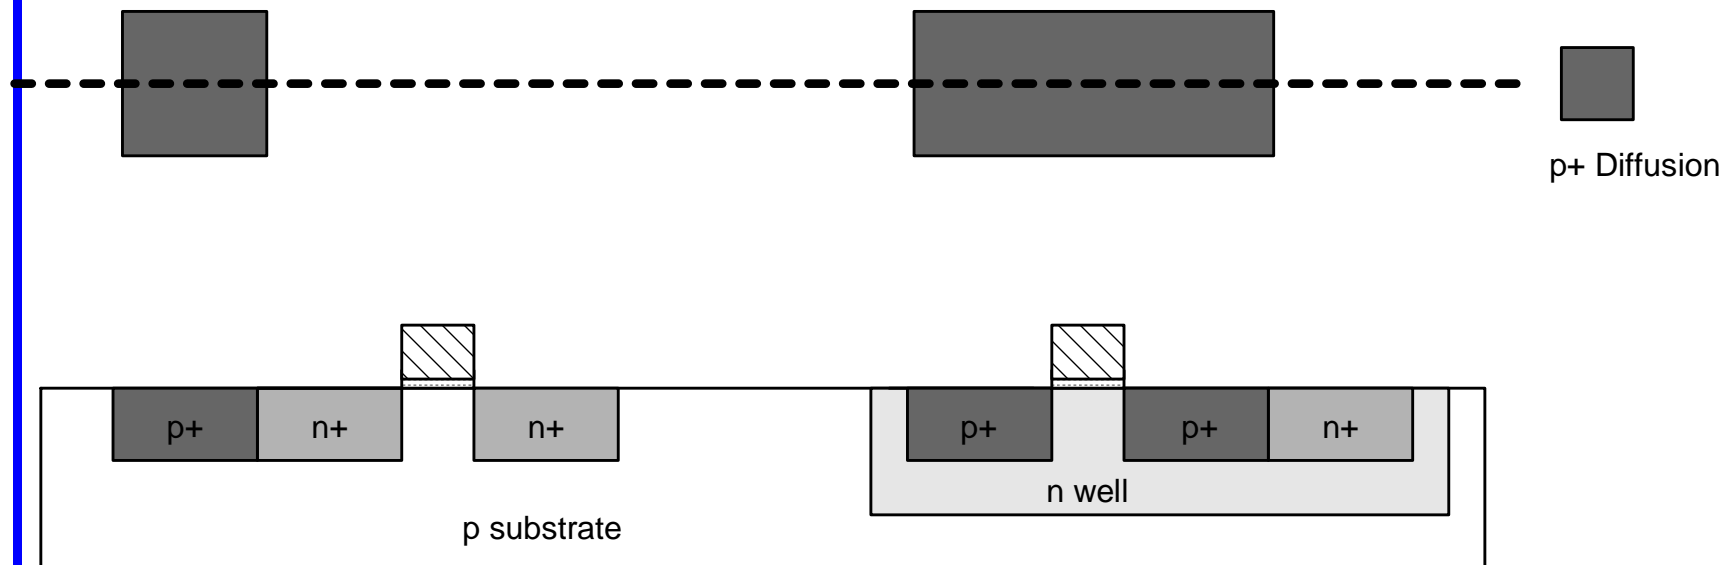

Contacts

- ❑ Now we need to wire together the devices
- ❑ Cover chip with thick field oxide
- ❑ Etch oxide where contact cuts are needed

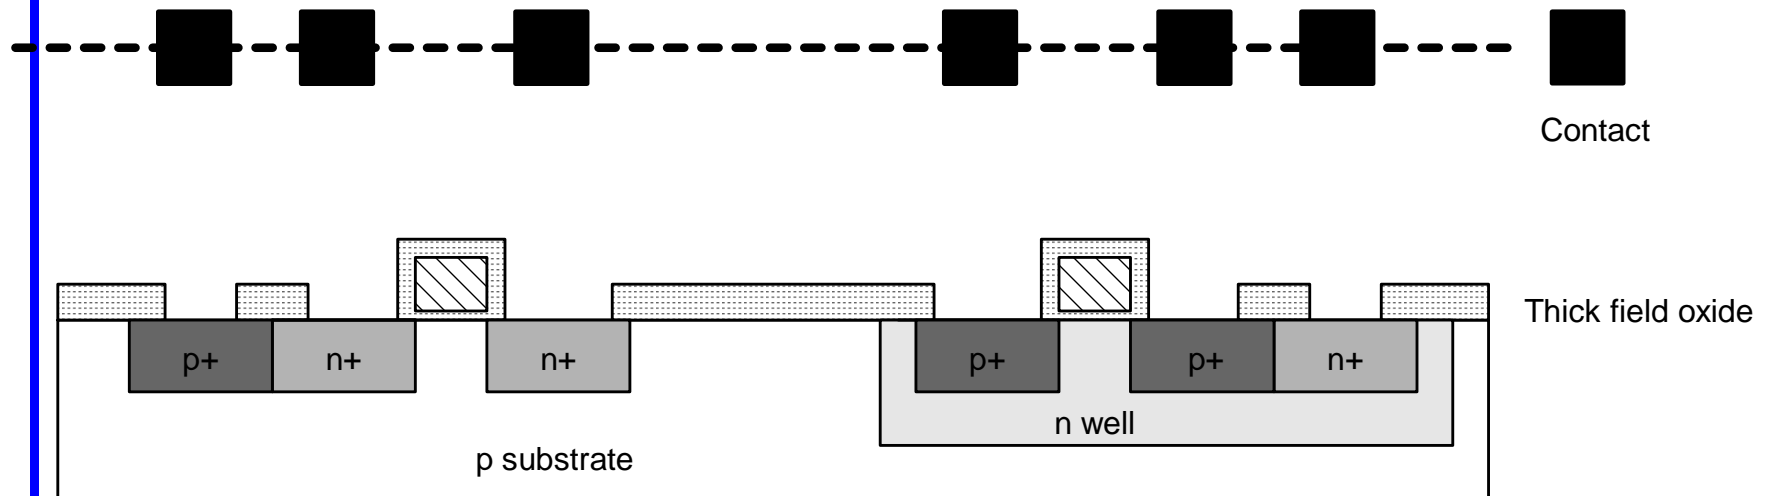

Metallization

- ❑ Sputter on aluminum over whole wafer
- ❑ Pattern to remove excess metal, leaving wires

